

Work Order ID-67355

Wednesday, March 16, 2011 11:55:19 AM



Page 1

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals:

Process Plan:

M

Date: 11-03-16

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D2580-041

Rev.D DEO-DI

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG005

8/11/11 *11-5-11*

110

0.00



BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1-Bend as per program D2580.C on CNC Bender and Folio 16

2-Cut tubes as per Dwg. D2580

DD

11-4-19

355

355

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355

Wednesday, March 16, 2011 11:55:19 AM

Page 2

Item ID: D205-634-041

Accept

Revision ID:

Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00

Required Date: 3/23/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

120

0.00



Skidtubes

Memo

0.00

1- Deburr ends and remove bending marks

2- Prepare tube for swaging as per QSI 002

130

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

[Handwritten signature]

[Handwritten signature]

11/04/25

1 D

BE11/04/27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355



Page 3

Wednesday, March 16, 2011 11:55:19 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Item Name: Replacement Skidtube

Stop



Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

140

0.00



Skidtubes

Skidtubes

Memo

0.00

1-Weld step D2576 as per Dwg. D2580 and QSI004
A/R ☐ ☐ Aluminum Rod

m16577

BE 11/04/27

2-Grind welds on step as per Dwg D2580

3-Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x 17G to start expansion and finish with 1/2 x 18G to achieve dwg dimension.

*WELDED
A/R m16577*

BE 11/04/27

4-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Deburr

BB

11/04/27

6-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Deburr

BE

7-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

BE 11/04/28

Counter Bore as per Dwg

150

0.00



QC

QC10- Inspect visual per QSI004- ground welds

0.00

Memo

Swage

(10)

Quality Control

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355

Wednesday, March 16, 2011 11:55:19 AM



Page 4

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00

Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

170

Pressure Wash per QSI005 4.3

0.00



HandFinish

Memo

0.00

Hand Finishing

Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.

①X
7m-l 11/05/05

180

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00



Powdercoat

Memo

0.00

Powder Coating

START TIME:
OVEN TEMPERATURE:
FINISH TIME:

8:10
320°F
8:40

①X X m-l 11/05/06

M 116964

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355

Wednesday, March 16, 2011 11:55:19 AM



Page 5

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

1 BR 11-5-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355

Wednesday, March 16, 2011 11:55:19 AM



Page 6

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

200

0.00



HandFinish

Hand Finishing

Memo

0.00

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of

Sikaflex on insert holes before installing wearplates

A/R ☐ ☐ ☐ Sikaflex-291 M46945

Sikaflex expire date: 12-01

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with

Sikaflex. Clean excess adhesive

A/R ☐ ☐ ☐ Sikaflex-291 M46945

Sikaflex expire date: 12-01

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M47315

1 br 11-5-10.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 67355

Page 7

Wednesday, March 16, 2011 11:55:19 AM

Item ID: D205-634-041

Accept



Setup Start



Revision ID:

Stop



Item Name: Replacement Skidtube

Start Date: 3/16/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 3/23/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

210



QC5- Inspect part completeness to step on W/O

0.00

8 11/5/11

QC

Memo

0.00

Quality Control

Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

10

220



Packaging

0.00

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPPD205-634-041

Location: _____

PPP Rev: _____

11/5/11

230



QC21- Final Inspection - Work Order Release

0.00

QC

Memo

0.00

Quality Control

11/5/11

UME
11-05-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:26 AM

Page 1

Work Order ID: 67355

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30
KJ IPP Rev P 10.02.19
per PAR09-043 EC verified by:DD
IPP Rev. O 06.02.28 Added paperwork EC
IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q
10.12.01 as per chg003 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D4202-1 Spacer	D2579	Manufactured	No			140	Each	504.0000	20	20			

Location	Loc Qty	Loc Code
LG	179	
67308	179	
LG002	325	
65329	13	
66121	1	
66929	110	
67129	201	

D2580-1 205 Skidtube bent detail	Manufactured	No				110	Each	7.0000	1	1			
-------------------------------------	--------------	----	--	--	--	-----	------	--------	---	---	--	--	--

Location	Loc Qty	Loc Code
LG	7	
59856	1	
66727	1	
66728	1	
67075	2	
67076	2	

BF 7/04/27
B68737 (20)

① 11-4-19



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:26 AM

Page 2

Work Order ID: 67355

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

D2576-3

Manufactured No

140 Each

29.0000

1

1



Step (maching detail)



BEU/04/27

Location

Loc Qty

Loc Code

LG

29

52215

29

D2855

Manufactured No

200 Each

80.0000

1

1



Cap

Location

Loc Qty

Loc Code

FP6

1

56613

1

fp7

9

65519

9

ST024

70

50513

1

50770

28

51539

2

53791 ✓

4

65569

35

AN3-5A

Purchased No

200 Each

689.0000

2

2



Bolt

Location

Loc Qty

Loc Code

ST350

689

115016

23

115371 ✓

500

116632

166

1 BL 11-5-10.

2 BL 11-5-10.

Wednesday, March 16, 2011 11:55:26 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:26 AM

Page 3

Work Order ID: 67355

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

AN960JD10L NAS1149D0332J Purchased

No

200

Each

4.0000

2

2



Washer

Location

Loc Qty

Loc Code

ST335

4

4

ALS7-1032-130 Purchased

No

200

Each

1,538.000

50

50



Insert

Location

Loc Qty

Loc Code

FP

21

21

ST282

1517

113238

17

115502

500

116800

1000

AN3C4A Purchased

No

200

Each

2,957.000

50

50



BOLT

Location

Loc Qty

Loc Code

ST350

2957

115300

25

116075

337

116924

1200

117010

395

117094

1000

117313

Wednesday, March 16, 2011 11:55:27 AM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:27 AM

Page 4

Work Order ID: 67355

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

AN960C10L NAS1149C0332 ✓ Purchased No

200 Each

-19.0000

50

50



washer

117291



50

BL 11-5-10.

Location

Loc Qty

Loc Code

ST297

-19

107534

-21

108246

2

D3566-13 Manufactured No

200 Each

53.0000

1

1



Gasket



Location

Loc Qty

Loc Code

FP011

36

66550 ✓

36

FP014

17

66137

17

D3566-5 Manufactured No

200 Each

32.0000

1

1



Gasket



Location

Loc Qty

Loc Code

FP015

32

63574

1

65528

10

66146

1

66552

20

67589

BL 11-5-10.

Wednesday, March 16, 2011 11:55:27 AM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:27 AM

Work Order ID: 67355



Parent Item: D205-634-041



Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

D3566-1

Manufactured No

200 Each

34.0000

2

2



Gasket

Location

Loc Qty

Loc Code

FP 68344 20
66548 20
FP011 11
65525 11
FP015 3
57715 1
66040 1
66129 1

2 11-5-10.

D3564-11

Manufactured No

200 Each

25.0000

1

1



Wearshoe

Location

Loc Qty

Loc Code

FP019 68350 25
65159 1
66154 16
66554 8

1 11-5-10.

D3564-13

Manufactured No

200 Each

63.0000

1

1



Wearshoe

Location

Loc Qty

Loc Code

FP16 40
66549 18
66805 22
FP17 23
59660 1
66136 22

1 11-5-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:27 AM

Work Order ID: 67355

Parent Item: D205-634-041

Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

D3564-9 Manufactured No

200 Each

23.0000

1

1



Wearshoe

Location

Loc Qty

Loc Code

FP

67590

~~67588~~

1

55334

1

FP019

21

65524

13

66153

8

FP19

1

62238

1

1

BL 11-5-10.

D3564-5 Manufactured No

200 Each

36.0000

1

1



Wearshoe

Location

Loc Qty

Loc Code

FG

67588

34806

1

1

FP19

24

57525

1

58709

1

66551

22

FP-19

11

63575

1

66148

10

1

BL 11-5-10.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, March 16, 2011 11:55:27 AM

Work Order ID: 67355



Parent Item: D205-634-041



Parent Item Name: Replacement Skidtube

Start Date: 3/16/2011

Required Date: 3/23/2011

Start Qty: 1.00

Required Qty: 1.00

D2594-3 Manufactured No

200 Each

839.0000

16

16



O-Ring, 205 Skidtube

Location

Loc Qty

Loc Code

FP 543
55546 19
58191 12
59358 12
65518 500

fpa 296
61762 296

16 BR 11-5-10.

D2594-1 Manufactured No

200 Each

568.0000

16

16



Plug, 205 Skidtube

Location

Loc Qty

Loc Code

FP 66932 483
42807 112
55002 71
66122 300
FP14 85
58434 15
65512 37
65980 33

16 BR 11-5-10.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07.06.28 *[Signature]*

DEO ATTACHED

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 67335

DP11-03-14

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

DETAIL A
SCALE 5:24

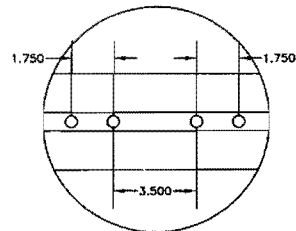


RELEASED
07.06.28


DETAIL B
SCALE 5:24

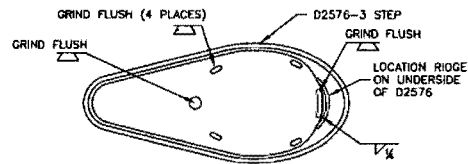


DETAIL C
SCALE 5:24

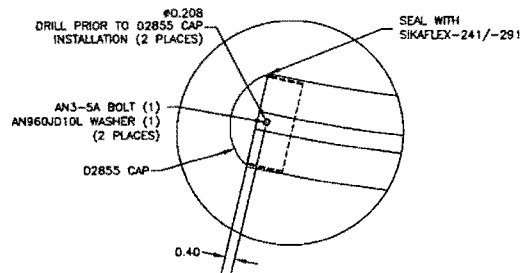


SECTION D-D
SCALE 5:24

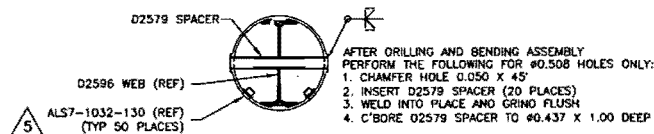


D2580-1 DRILLING DETAIL

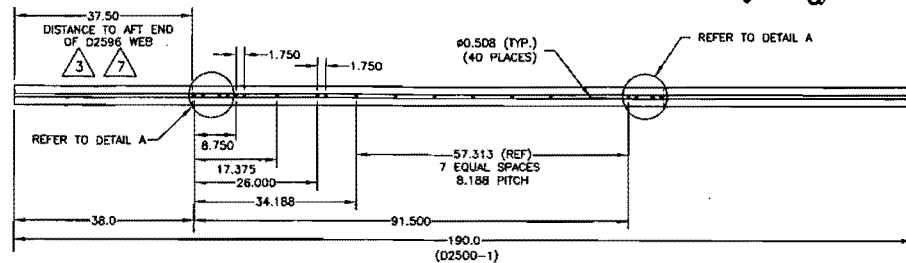

D2580-1 BENDING AND CUTTING DETAIL

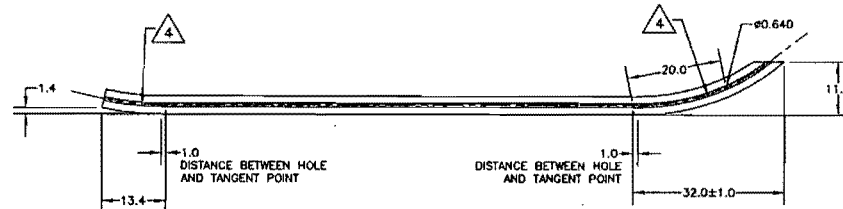

D2580-041 ASSEMBLY DETAIL

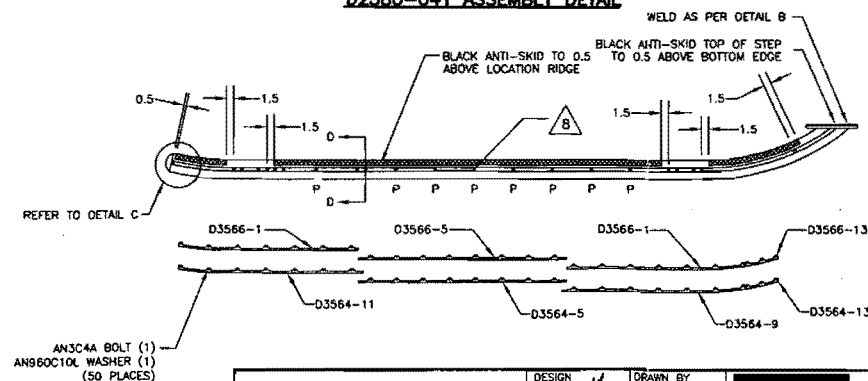

D2580-041 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1999 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE		D2580	SHEET 2 OF 3
07.02.27		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D2580	TITLE 205 SKIDTUBE ASSEMBLY	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2580-D-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>L</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>H</i>		
DATE 10.09.22	DATE 10.11.04	DATE 10.11.04	DATE 10/11/04		DATE 10.11.04		

PURPOSE:

CHANGE ALL WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:


WAS

QTY	QTY	PART NUMBER	DESCRIPTION
-041	-045		
20	24	D2579	CROSS BOLT SPACER

IS

20	24	D4202-1	SPACER
----	----	---------	--------

SECTION D-D & SECTION H-H ARE AMENDED AS FOLLOWS:

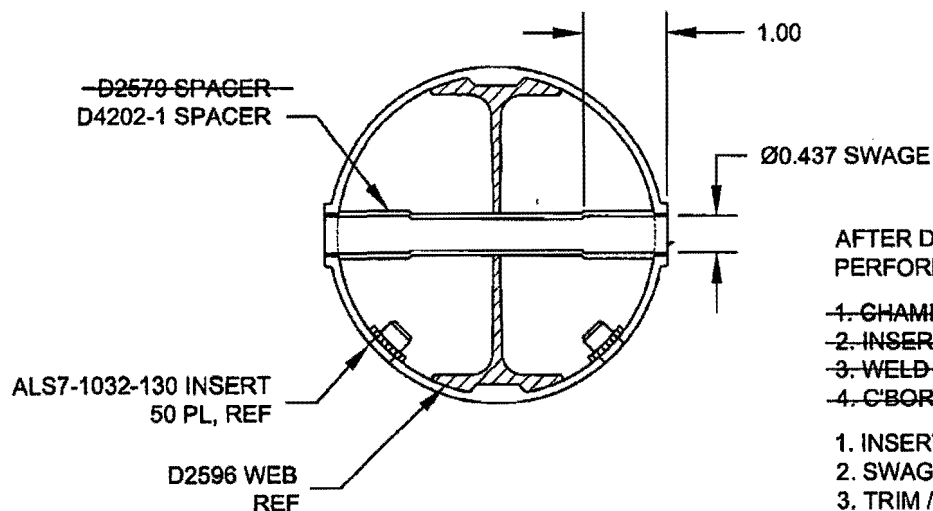

SECTION D-D
NOT TO SCALE

SECTION H-H
NOT TO SCALE

RELEASED
2010-11-18
MP

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

1. INSERT D4202-1 SPACER, 20 PL (-041) OR 24 PL (-045)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Linda Lacelle

From: dshepherd@dartaero.com
Sent: April 18, 2011 11:36 AM
To: Linda Lacelle; Mike Petsche
Cc: Bill Beckett; 'Chris Provencal'; 'Eric Charbonneau'
Subject: Re: Alum. Solution Anneal - swaging

Makes sense to me ... We don't want to get caught short ... Make sure that if we do this, they are identified with the old CHG number.

David

Sent from my BlackBerry device on the Rogers Wireless Network

From: "Linda Lacelle" <llacelle@dartaero.com>
Date: Mon, 18 Apr 2011 11:21:10 -0400
To: 'Mike Petsche' <mpetsche@dartaero.com>; <dshepherd@dartaero.com>
Cc: 'Bill Beckett' <bbeckett@dartaero.com>; 'Chris Provencal' <cprovencal@dartaero.com>; 'Eric Charbonneau' <echarbonneau@dartaero.com>
Subject: RE: Alum. Solution Anneal - swaging

I am ready to weld some up, I don't want to get into trouble with L/T's on these, any objections??

LL

From: Mike Petsche [mailto:mpetsche@dartaero.com]
Sent: April 18, 2011 10:42 AM
To: 'Linda Lacelle'; dshepherd@dartaero.com
Cc: 'Bill Beckett'; 'Chris Provencal'; 'Eric Charbonneau'
Subject: RE: Alum. Solution Anneal - swaging

Well I'm not sure what to say.

CHG ^{CO7} ~~CO7~~ D2579

It is my understanding that the swaging will still make sense even with the extra hoops we need to jump through.

If there is still uncertainty on the delivery of the material, we CAN still weld them if we need to.

And while this might be less than "world class", couldn't we take some of our tubing that we have in stock and zap it with the welder to knock down the temper a little? Ground clamp on one end, torch on the other.....BZZZZZZT.

(I'm only sort of joking....because I bet it would work)

From: Linda Lacelle [mailto:llacelle@dartaero.com]
Sent: April 18, 2011 9:44 AM
To: dshepherd@dartaero.com; 'Mike Petsche'
Cc: Bill Beckett; Chris Provencal; Eric Charbonneau
Subject: RE: Alum. Solution Anneal - swaging
Importance: High

So any thoughts about going fwd for now with 205's? We are down to 6, and I don't want to run out as we have orders for these for early May.

LL

From: Linda Lacelle [mailto:llacelle@dartaero.com]

Sent: April 12, 2011 8:11 AM

To: dshepherd@dartaero.com; 'Mike Petsche' (mpetsche@dartaero.com)

Cc: Bill Beckett (bbeckett@dartaero.com); Chris Provencal (cprovencal@dartaero.com); Eric Charbonneau (echarbonneau@dartaero.com)

Subject: FW: Alum. Solution Anneal - swaging

So if we send them 400 pcs of the 6061T6 tube, they can temper it to T4 for a cost of 1850.00...

LL

From: John Spencer [mailto:johns@metcor.biz]

Sent: April 12, 2011 8:04 AM

To: llacelle@dartaero.com

Subject: Alum. Solution Anneal

Linda,

Metcor could process the tubes within a few days after receiving.

Price for the lot is \$1850 including conductivity test.

Would prefer 8 inch cut to length, if not we could manage 4 " lengths .

Please let me know and contact me on my cell.

Regards,

John Spencer

Metcor Inc.

Nadcap Certified

johns@metcor.biz

514-386-1620

11

Linda Lacelle

From: Mike Petsche <mpetsche@dartaero.com>
Sent: April 18, 2011 10:42 AM
To: 'Linda Lacelle'; dshepherd@dartaero.com
Cc: 'Bill Beckett'; 'Chris Provencal'; 'Eric Charbonneau'
Subject: RE: Alum. Solution Anneal - swaging

Well I'm not sure what to say.

It is my understanding that the swaging will still make sense even with the extra hoops we need to jump through.

If there is still uncertainty on the delivery of the material, we CAN still weld them if we need to.

And while this might be less than "world class", couldn't we take some of our tubing that we have in stock and zap it with the welder to knock down the temper a little? Ground clamp on one end, torch on the other.....BZZZZZZT.

(I'm only sort of joking....because I bet it would work)

From: Linda Lacelle [mailto:llacelle@dartaero.com]
Sent: April 18, 2011 9:44 AM
To: dshepherd@dartaero.com; 'Mike Petsche'
Cc: Bill Beckett; Chris Provencal; Eric Charbonneau
Subject: RE: Alum. Solution Anneal - swaging
Importance: High

So any thoughts about going fwd for now with 205's? We are down to 6, and I don't want to run out as we have orders for these for early May.

LL

From: Linda Lacelle [mailto:llacelle@dartaero.com]
Sent: April 12, 2011 8:11 AM
To: dshepherd@dartaero.com; 'Mike Petsche' (mpetsche@dartaero.com)
Cc: Bill Beckett (bbeckett@dartaero.com); Chris Provencal (cprovencal@dartaero.com); Eric Charbonneau (echarbonneau@dartaero.com)
Subject: FW: Alum. Solution Anneal - swaging

So if we send them 400 pcs of the 6061T6 tube, they can temper it to T4 for a cost of 1850.00..

LL

From: John Spencer [mailto:johns@metcor.biz]
Sent: April 12, 2011 8:04 AM
To: llacelle@dartaero.com
Subject: Alum. Solution Anneal

Linda,
Metcor could process the tubes within a few days after receiving.
Price for the lot is \$1850 including conductivity test.
Would prefer 8 inch cut to length, if not we could manage 4 " lengths.
Please let me know and contact me on my cell.

22579 0
9

NO. 249

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 67531
Part number: D205 634 041
Description: 205
Welding Process: Tig ☒ Mig ☐
Base material: Aluminum
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐
Undercut: pass ☒ fail ☐
Pin holes: pass ☒ fail ☐
Overlap (cold lap): pass ☒ fail ☐
Porosity (surface): pass ☒ fail ☐
Coloration: pass ☒ fail ☐

Qualifier Lat Farnsworth Date of Test Coupon 11.04.25

Welder Barclay Elliott Date of Test Coupon 11.04.25

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

